



GM Fuel Pump Module Wiring Harness Repair Kits from Airtex

The Problem:

Many GM vehicles from 1988 to 2005 have electrical connectors on the fuel pump module that may become loose over time due to vibration, leading to faulty, high-resistance connections. The symptoms - burned or melted connectors and pins - lead to a voltage drop situation where low or no voltage can cause the module to stop pumping.

The Solution:

Airtex's latest fuel system solution provides a quick and reliable fix for burned or melted wiring harness connections on certain GM in-tank fuel pump applications. Airtex offers wire harness kits with the proper mating connector and wire gauge (PNs WH-3000, WH-3001, WH-3002 and WH-3003) to address GM fuel pump module connector problems.

Always inspect the wiring harness and connector for damage when replacing a GM fuel pump module, and replace with a new harness, if necessary, to avoid costly comebacks and potentially hazardous conditions. Contact your local Airtex distributor for more information and to order the replacement harness for your application.



WH-3001



WH-3002



WH-3003






GM Wiring Harnesses


Part Number Used with Airtex Fuel Pump Modules

WH-3000	E3621S, E3622S, E3623S
WH-3001	E3368M, E3369M, E3372M, E3500M, E3501M, E3506M, E3507M, E3509M, E3510M, E3511M, E3512M, E3513M, E3514M, E3518M, E3521M, E3529M, E3533M, E3535M, E3536M, E3537M, E3538M, E3542M, E3543M, E3919M, E3920M, E3923M, E3925M, E3927M, E3928M, E3929M, E3935M, E3936M, E3939M, E3940M, E3941M, E3942M, E3945M, E3947M, E3948M, E3950M, E3952M, E3953M, E3954M, E3956M, E3957M, E3962M, E3963M, E3965M, E3966M, E3967M, E3968M, E3969M, E3971M, E3972M, E3973M, E3974M, E3976M, E3978M, E3979M, E3980M, E3982M, E3992M, E3994M, E3996M, E3997M
WH-3002	E3912M, E3913M, E3914M, E3916M, E3917M, E3918M, E3921M, E3922M, E3926M, E3930M, E3932M, E3937M, E3938M, E3995M
WH-3003	E3943M


*Consult Airtex catalog for specific vehicle applications.

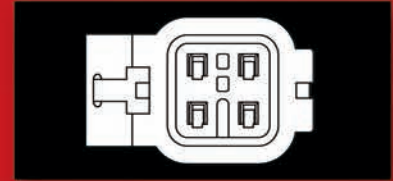

WH-3001
Note Indexing/Keying Positions

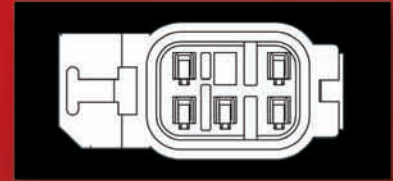


WH-3002
Replacement connector supplied as 5-wire unit; For 4-wire applications, remove unneeded terminal

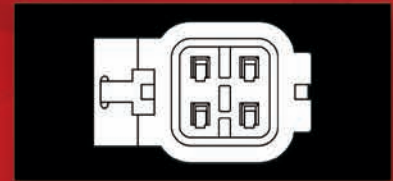

WH-3003
Note Indexing/Keying Positions

Harness Connector

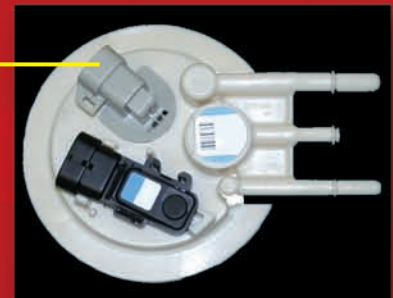

TYPICAL GM FUEL MODULE

